

Leonardo S.p.A. Via Giovanni Agusta, 520 21017 Cascina Costa di Samarate (VA) Italy Tel.: +39 0331 229111 - Fax: +39 0331 229605/222595

AgustaWestland Products

SERVICE BULLETIN

_№ 189-237

EMERGENCY ALERT

DATE: May 29, 2019

REV.: A - September 5, 2019

TITLE

ATA 64 - TAIL ROTOR FLIGHT CONTROL IMPROVED PERIODICAL INSPECTION

REVISION LOG

Revision A of this Service Bulletin cancels and supersedes the previous Revision /.

Revision A is issued in order to introduce the following changes:

- Update the "Compliance" section clarifying the note relevant to accomplishment of Part VI.
- Provide instruction to remove the castellated nut in place of loosen it while performing the replacement of the TR duplex bearing.
- Add closure action in case of findings after accomplishment with Part VI step 3.
- Add cleaning instruction of the TR duplex bearing area in Part V before installation of the spider plug.
- Add details to cleaning procedure of spacer control rod surface with aliphatic naphtha.
- Add use of a borescope as alternative mean to perform inspection of Part I, in such case the removal of the access panels 495A and 496A is not required.
- In case of no-findings after the inspections, it is not required anymore to send feedback to LHD.
- Add HUMS data download in case TRA HUMS accelerometer has been already installed to helicopter.
- Update the reference to Annex A UTC Microtecnica Service Bulletin 67-0006 Issue 1.



Revision bars in the margins identify changes.



1. PLANNING INFORMATION

A. EFFECTIVITY

Part I: All AW189 helicopters.
Part II: All AW189 helicopters.
Part III: All AW189 helicopters.
Part IV: All AW189 helicopters.
Part V: All AW189 helicopters.

Part VI: All AW189 helicopters.

B. COMPLIANCE

Part I:

Within 10 FH from last application of Part I of SB 189-224 or from the issue of this Service Bulletin, whichever occurs first. Then repeat the inspection every 10 FH.

NOTE

Every time it is required to perform Part II, accomplishment of Part I, Part IV and Part V on the same maintenance downtime, must be performed as a prerequisite.

If Part III is required in the same maintenance downtime, it shall be performed last.

Part II:

Within 50 FH from last application of Part II of SB 189-224 or from the issue of this Service Bulletin, whichever occurs first. Then repeat the inspection every 50 FH.

Part III:

Within 20 FH from last application of Part III of SB 189-224 or from the issue of this Service Bulletin, whichever occurs first. Then repeat the installation every 20 FH.

Part IV:

Within 10 FH from last application of Part IV of SB 189-224 or from the issue of this Service Bulletin, whichever occurs first. Then repeat the inspection every 10 FH.

NOTE

Perform as a prerequisite Part I and Part IV.

If Part III is required in the same maintenance downtime, it shall be performed lastly.

S.B. N°189-237 EMERGENCY ALERT

DATE: May 29, 2019



Part V:

Within 10 FH from last application of Part I of SB 189-224 or from the issue of this Service Bulletin, whichever occurs first. Then repeat the inspection every 10 FH.

NOTE

- After the first accomplishment of Part VI repeat Part VI phased with Part II, not exceeding 200FH from the first application of the Part VI. Then repeat every 200FH.
- Perform in sequence Part I, Part IV, Part V as a prerequisite.
- If Part II is required in the same maintenance downtime, it shall be performed after Part V and before Part VI.
- If Part III is required in the same maintenance downtime, it shall be performed after Part VI.

Part VI:

Within 10 FH from last application of Part I of SB 189-224 or from the issue of this Service Bulletin, whichever occurs first. Then repeat the inspection every 200 FH.

C. CONCURRENT REQUIREMENTS

This SB supersedes and replaces the SB 189-224.

D. REASON

This Service Bulletin is issued in order to require the periodical inspection of the slippage marking of the back-end castellated nut of the TR servo-actuator and the periodical detailed inspection of the TR duplex bearing.

E. DESCRIPTION

Following additional tests and the completion of the initial phase of the in service monitoring carried out on the AW169 and AW189 fleet, it has been confirmed that the introduction of a temperature monitoring represents an effective independent measure to confirm the health of the TR bearing. In addition a refinement of the current inspection schedule is required with this SB along with the introduction of an additional instruction for duplex bearing roughness check.

This Service Bulletin provides the instructions for the above together with the transition to the new inspection regime.



In details Part I of this Service Bulletin provides the periodical detailed inspection of the slippage marking of the castellated nut installed on the back end of the TRA.

Part II partly retains the requirement of the Part II of the SB 189-224 defining the required detailed inspection requirement of TR duplex bearing.

Part III provides the instructions to install a dedicated thermal strip in the area of the TR duplex bearing.

Part IV provides the instructions to recursively check the thermal strip.

Part V requires the verification of metallic particle presence in the grease that could be found on the visible part of the duplex bearing. This check was already present in the Part II of the SB 189-224 and it is now confirmed with a tighter compliance.

Part VI prescribe an additional roughness check of the duplex bearing to be performed after removal of the spider assembly.

Incorrect installation of the TR servo-actuator back-end nut or seizure of the TR duplex bearing may lead to loss of Tail Rotor control which, depending on the flight condition, could lead to loss of control of the aircraft.

Feedback on the compliance to this Service Bulletin is required.

Revision A of this Service Bulletin allows the simplification of Part I inspection and reduce the amount of feedback required after "no-findings" inspections.

F. APPROVAL

The technical content of this Service Bulletin is approved under the authority of DOA nr. EASA.21.J.005. For helicopters registered under other Aviation Authorities, before applying the Service Bulletin, applicable Aviation Authority approval must be checked within Leonardo Helicopters customer portal.

E.A.S.A. states mandatory compliance with inspections, modifications or technical directives and related time of compliance by means of relevant Airworthiness Directives.

If an aircraft listed in the effectivity embodies a modification or repair not LHD certified and affecting the content of this Service Bulletin, it is responsibility of the Owner/Operator to obtain a formal approval by Aviation Authority having jurisdiction on the aircraft, for any adaptation necessary before incorporation of the present Service Bulletin.

G. MANPOWER

To comply with this Service Bulletin the following MMH are deemed necessary:

Part I: approximately one (0.5); Part II: approximately three (3);

S.B. N°189-237 EMERGENCY ALERT

DATE: May 29, 2019



Part III: approximately half (0.5);

Part IV: approximately one (1).

Part V: approximately one (0.5);

Part VI: approximately three (3);

MMH are based on hands-on time and can change with personnel and facilities

available.

H. WEIGHT AND BALANCE

N.A.

I. REFERENCES

1) PUBLICATIONS

DATA N	MODULE	DESCRIPTION	<u>PART</u>
DM01	89-A-00-20-00-00A-120A-A	Helicopter on ground for a safe	I, II; III,
		maintenance.	IV, V, VI
DM02	89-A-06-41-00-00A-010A-A	Access door provision	I, II
DM03	89-A-64-31-01-00A-520A-A	Pitch link - Remove procedure	II
DM04	89-A-64-31-01-00A-720A-A	Pitch link - Install procedure	II, IV, V,
			VI
DM05	89-A-64-31-03-00A-520A-A	Spider plug - Remove procedure	II, III,
			IV,V
DM06	89-A-64-31-03-00A-720A-A	Spider plug - Install procedure	II, III, IV,
			V
DM07	89-A-64-31-02-00A-520A-A	Scissors group – Remove	II
		procedure	
DM08	89-A-64-31-04-00A-520A-A	Spider and slider assembly -	II, VI
		Remove procedure	
DM09	89-A-64-31-04-00A-720A-A	Spider and slider assembly -	II, VI
		Install procedure	
DM10	89-A-64-31-05-00A-520A-B	Duplex bearing - Remove	II, IV, V,
		procedure	VI
DM11	89-A-64-31-05-00A-720A-B	Duplex bearing - Install procedure	
			VI

2) ACRONYMS

SB	Service Bulletin
DM	Data Module
DOA	Design Organization Approval
EASA	European Aviation Safety Agency
LHD	Leonardo Spa Helicopters

S.B. N°189-237 EMERGENCY ALERT

DATE: May 29, 2019



MMH Maintenance Man Hours

SB Service Bulletin

FH Flight Hours

TR Tail Rotor

TRA Tail Rotor Actuator

3) ANNEX

Annex A UTC AEROSPACE SYSTEMS SB 67-0006 Issue 1.

J. PUBLICATIONS AFFECTED

N.A.

K. SOFTWARE ACCOMPLISHMENT SUMMARY

N.A.

S.B. N°189-237 EMERGENCY ALERT

DATE: May 29, 2019



2. MATERIAL INFORMATION

A. REQUIRED MATERIALS

1) PARTS

Refer to AW189 IPD for the spares materials required to comply with the AMP DMs referenced in the accomplishment instructions.

2) CONSUMABLES

The following consumable materials, or equivalent, are necessary to accomplish this Service Bulletin:

#	Spec./LHD code number	DESCRIPTION	Q.TY	NOTE	PART
1	Thermax 8 Level strip indicator code No.26805	Thermal strip	AR	(1)(2)(3)	III,IV
2	TT-N-95-B / Code No. 531055030	Aliphatic Naphtha (C059)	AR	(1)	III,IV

Refer to AW189 AMDI for the consumables required to comply with the AMP DMs referenced in the accomplishment instructions.

3) LOGISTIC MATRIX

N.A.

NOTE

- (1) Item to be furnished as local supply.
- (2) Thermal strip Thermax 5 Level clock style indicator code No.26004 may be used as a valid alternative.
- (3) The use of further alternative strip is allowed provided that it complies with the following requirements:
 - Irreversible temperature indication.
 - Self-Adhesive.
 - Temperature Range shall be included within 100°C 160°C provided that it shows a discrete level at 121±2°C.
 - Overall measurement accuracy: ±2°C.
 - The maximum allowed length to prevent overlap is 80 mm.

In case any clarification is needed, contact the Product Support Engineering (pse aw189.mbx.aw@leonardocompany.com).



B. SPECIAL TOOLS

Refer to ITEP for the special tools required to comply with the AMP DMs referenced in the accomplishment instructions.

C. INDUSTRY SUPPORT INFORMATION

Owners/Operators who comply with the instructions of this Service Bulletin no later than the applicable date in the "Compliance" section will be eligible to receive REQUIRED MATERIALS on free of charge basis, except for Consumable Materials and Special Tools.

NOTE: Customers who fail to comply with the instructions in this Service Bulletin before the compliance date are not eligible for the aforementioned special policy.

Please Issue relevant MMIR form to your Warranty Administration Dpt.

NOTE: WRM will include RETURN MATERIAL AUTHORIZATION (RMA) number; the unit disembarked from the aircraft has to be returned to LHD within thirty (30) calendar days after the shipment of the replacement part. In case of missing return within thirty (30) calendar days, Customer will be invoiced for the price of the replacement part.

S.B. N°189-237 EMERGENCY ALERT

DATE: May 29, 2019



3. ACCOMPLISHMENT INSTRUCTIONS

GENERAL NOTES

a) Place an identification tag on all components that are re-usable, including the attaching hardware that has been removed to gain access to the modification area and adequately protect them until their later re-use.

PART I

1. In accordance with AMP DM 89-A-00-20-00-00A-120A-A, prepare the helicopter on ground for a safe maintenance. Disconnect the battery, all electrical power sources and/or the external power supply.

NOTE

Removal of access panels 496A and 495A can be avoided if visual access to the inspection area is available by other means. A suitable boroscope can be inserted in the grid of access panel 496A as shown on Figure 3.

- 2. In accordance with AMP DM 89-A-06-41-00-00A-010A-A, remove the access panels 496A and 495A.
- 3. Take a picture of the back-end area of the TRA clearly showing the slippage mark, and keep a record in a local archive to be made available if required.
- 4. With reference to Figure 3, check the slippage mark on the castellated nut for absence of evidence of rotation between the parts. Record the result on Table I (refer to Figure 7).
 - 5. If any evidence of rotation is found, contact the Product Support Engineering (pse aw189.mbx.aw@leonardocompany.com), wait for further instructions before to perform the following checks:
 - 5.1 Perform Part II of this SB;
 - 5.2 Perform Part V of this SB;
 - 5.3 Send the picture taken at step 3 to Product Support Engineering (pse aw189.mbx.aw@leonardocompany.com).
 - 5.4 If the helicopter is already compliant with the SB 189-227, perform HUMS data download from AMMC to DTD. Upload the HUMS data to Heliwise.

Page 10 of 48 REVISION: A - September 5, 2019



- 6. If no evidence of rotation is found in step 4, return the helicopter to a ready to flight condition and record for compliance with Part I of this Service Bulletin on the helicopter logbook.
- 7. Send the attached compliance form and the compiled Table I to the following mail box: pse_aw189.mbx.aw@leonardocompany.com

As an alternative, gain access to My Communications section on Leonardo WebPortal and compile the "Service Bulletin Application Communication".

S.B. N°189-237 EMERGENCY ALERT

DATE: May 29, 2019



PART II

- 1. In accordance with AMP DM 89-A-00-20-00-00A-120A-A, prepare the helicopter on ground for a safe maintenance. Disconnect the battery, all electrical power sources and/or the external power supply.
- 2. In accordance with AMP DM 89-A-64-31-03-00A-520A-A, remove the spider plug.
- 3. In accordance with AMP DM 89-A-64-31-01-00A-520A-A, remove all the pitch links from the TR.
- 4. In accordance with applicable steps of AMP DM 89-A-64-31-02-00A-520A-A, disconnect the upper half scissors from the spider.
- 5. Remove and discard the strap that attach the boot to the spider and slider assembly. Disconnect and lower the boot from the spider.
- 6. Perform the inspection of the TR duplex bearing in accordance with the following procedure:
 - 6.1 Inspect the visible part of the TR duplex bearing (including the seals) for absence of wear, damages and security of attachment. Record the results on Table II (refer to Figure 8).
 - 6.2 Check for absence of axial play when trying to move the spider along the control rod axis. Record the result on Table II (refer to Figure 8).

NOTE

With reference to Figure 1 and Figure 2 Details B and C, apply a 35 ± 2.5 N upward force on the squared rod end by means of a dynamometer while performing the instructions reported in steps from 6.3 to 6.7. It is allowed to apply the force either pushing or pulling the rod end with the dynamometer.

- 6.3 Perform at least three (3) complete and continuous revolutions of the spider both in clockwise and in counterclockwise directions and verify that the spider has a free and easy rotation. Record the result on Table II (refer to Figure 8).
- 6.4 Put one arm of the spider along the vertical position; locate a dynamometer gauge on the spider arm hole (pitch link upper bolt location). Hold the gauge perpendicular to the spider arm surface. Gently push rightward the device until a slight rotation of the spider occurs (see Figure 2 for further details and dynamometer positioning). Record the force measured on Table II (refer to Figure 8).
- 6.5 Repeat step 6.4 for the opposite spider rotation on the same arm, pushing leftward the dynamometer gauge from the vertical position of the spider arm.



- Record the force measured on Table II (refer to Figure 8).
- 6.6 Repeat steps 6.4 and 6.5 for all the other three spider arms.
- 6.7 The force detected by dynamometer on steps 6.4 thru 6.6 shall be measured within 2 N and 10 N.
- 7. If none of the checks performed in step 6 fails proceed as follows, otherwise skip to step 8.

Removal of access panel 496A can be avoided if visual access to the inspection area is available by other means. A suitable boroscope can be inserted in the grid of access panel 496A as shown on Figure 3.

- 7.1 In accordance with AMP DM 89-A-06-41-00-00A-010A-A, remove the access panels 496A and 495A.
- 7.2 With reference to Figure 3, check the slippage mark on the castellated nut for absence of evidence of rotation between the parts by means of the borescope. If any evidence of rotation is found, immediately contact the PSE (pse aw189.mbx.aw@leonardocompany.com) and wait for further instructions.
- 7.3 If the helicopter is already compliant with the SB 189-227, perform HUMS data download from AMMC to DTD. Upload the HUMS data to Heliwise.
- 7.4 Skip to step 12.
- 8. If one of the checks performed from step 6.1 to 6.2 fails skip to step 10, otherwise proceed with the following step 9.
- 9. If one of the checks performed from step 6.3 to step 6.7 fails proceed as follows:
 - 9.1 Perform the cleaning procedure of the sliding control assy in accordance with the following procedure:
 - 9.1.1 In accordance with AMP DM 89-A-06-41-00-00A-010A-A remove the access panels 496A and 495A.

CAUTION

Pay attention to prevent rod rotation, when screwing / un-screwing the castellated nut, holding the rod square end.

- 9.1.2 In accordance with the applicable steps of UTC SB 67-0006, remove and discard the cotter pin and the lockwire from the castellated nut of the TRA back-end and remove the nut.
- 9.1.3 In accordance with applicable steps of AMP DM 89-A-64-31-04-00A-520A-A, remove the spider and slider assembly.

S.B. N°189-237 EMERGENCY ALERT

DATE: May 29, 2019



- 9.1.4 Clean the external surface of the spider and slider assembly by means of soft lint-free cloth.
- 9.1.5 Clean the accessible internal surface of the slider bushing by means of soft lint-free cloth.
- 9.1.6 In accordance with applicable steps of AMP DM 89-A-64-31-04-00A-720A-A, reinstall the spider and slider assembly.

CAUTION

Pay attention to prevent rod rotation, when screwing / un-screwing the castellated nut, holding the rod square end

- 9.1.7 In accordance with the applicable steps of UTC SB 67-0006, reinstall castellated nut of the TRA back-end and cotter pin P/N EN2367-29020 and lockwire P/N MS20995C20.
- 9.1.8 With reference to Figure 3, restore the slippage marking on the castellated nut from the hinge bracket element to the rod.
- 9.2 Repeat steps from 6.2 to 6.7 to verify the absence of axial play of TR duplex bearing and to perform again the roughness and breakaway force checks of TR duplex bearing.
- 9.3 If any of the checks performed in step 9.2 fails proceed with the following step 10, otherwise skip to step 12.
- 10. Contact immediately the Product Support Engineering (pse aw189.mbx.aw@leonardocompany.com) to receive further instruction before performing the replacement of the TR duplex bearing in accordance with the following procedure:
 - 10.1 If the helicopter is already compliant with the SB 189-227, perform HUMS data download from AMMC to DTD. Upload the HUMS data to Heliwise.

CAUTION

Pay attention to prevent rod rotation, when screwing / un-screwing the castellated nut, holding the rod square end.

10.2 In accordance with the applicable steps of UTC SB 67-0006, remove and discard the cotter pin and the lockwire from the castellated nut of the TRA back-end and remove the nut.

S.B. N°189-237 EMERGENCY ALERT DATE: May 29, 2019



Before removal of the TR duplex bearing, take note of its installation orientation marking "OUT" on the outboard visible face.

After removal mark "IN" on the inboard opposite face of the TR duplex bearing.

Use an indelible pen.

- 10.3 In accordance with AMP DM 89-A-64-31-05-00A-520A-B, remove the TR duplex bearing.
- 10.4 Collect the grease leaked from the TR duplex bearing "IN" marked side in a container different from the one used before.
- Take a picture of both faces of the removed TR duplex bearing and send them to PSE (pse_aw189.mbx.aw@leonardocompany.com) before returning the bearing.
- 10.6 Clean by means of a soft lint-free cloth the housing of the TR duplex bearing, the rod visible part and the internal side of the spider plug.
- 10.7 In accordance with AMP DM 89-A-64-31-05-00A-720A-B, install a new TR duplex bearing.

CAUTION

Pay attention to prevent rod rotation, when screwing / un-screwing the castellated nut, holding the rod square end.

- 10.8 In accordance with the applicable steps of UTC SB 67-0006, reinstall castellated nut of the TRA back-end and cotter pin P/N EN2367-29020 and lockwire P/N MS20995C20.
- 10.9 With reference to Figure 3, restore the slippage marking on the castellated nut from the hinge bracket element to the rod.
- 11. In case replacement of the TR duplex bearing is required, please return immediately (within 2 days) the removed TR duplex bearing and the collecting containers of the grease to Leonardo Helicopters. Contact the Product Support Engineering (pse aw189.mbx.aw@leonardocompany.com) to receive the proper instructions to return the removed component.
- 12. In accordance with AMP DM 89-A-64-31-01-00A-720A-A, while performing installation of TR pitch links, it is possible to re-protect TR pitch links and the scissors using the following procedure.
 - 12.1 Clean the bolts by means of cleaning solvent.

S.B. N°189-237 EMERGENCY ALERT

DATE: May 29, 2019



- 12.2 Check the bolts looking for corrosion. Contact the Product Support Engineering (pse aw189.mbx.aw@leonardocompany.com) in case of any findings.
- 12.3 Protect the parts using Tectyl Grade I or Thixoflex Black as a valid alternative.
- 13. In accordance with AMP DM 89-A-64-31-03-00A-720A-A, install the spider plug.

In case of any findings, report within 2 days the inspection results along with the available records of the previous checks.

14. Send the attached compliance form and the compiled Table II to the following mail box:

pse_aw189.mbx.aw@leonardocompany.com

As an alternative, gain access to My Communications section on Leonardo WebPortal and compile the "Service Bulletin Application Communication".

15. Return the helicopter to a ready to flight condition and record for compliance with Part II of this Service Bulletin on the helicopter logbook.



PART III

- 1. In accordance with AMP DM 89-A-00-20-00-00A-120A-A, prepare the helicopter on ground for a safe maintenance. Disconnect the battery, all electrical power sources and/or the external power supply.
- 2. In accordance with AMP DM 89-A-64-31-03-00A-520A-A, remove the spider plug.
- 3. With reference to Figure 4, perform the installation of thermal strip Thermax 8 level strip No.26805 or equivalent as follows:
 - 3.1 Clean the spacer control rod P/N 4F6430A02551 surface with a soft lint-free cloth soaked with a small quantity of aliphatic naphtha. Then dry the surface with a clean cloth.
 - 3.2 With reference to Figure 5, if the selected thermal strip exceeds the height of 16 mm it shall be cut taking care not to remove the Celsius scale and not to damage the sensitive elements of the strip.

CAUTION

When installing the thermal strip pay attention to:

- avoid contact with bearing gaskets;
- ensure a good adhesion with the spacer control rod P/N 4F6430A02551;
- all temperature indicators of the thermal strip shall be visible.

CAUTION

If thermal strip trimming is required, confirm that the cut did not cause debonding of strip layers.

- 3.3 With reference to Figure 4, with the help of a non metallic spatula, perform the installation of the thermal strip on the surface of the spacer control rod P/N 4F6430A02551.
- 4. In accordance with AMP DM 89-A-64-31-03-00A-720A-A, install the spider plug.
- Return the helicopter to a ready to flight condition and record for compliance with Part III of this Service Bulletin on the helicopter logbook.
- 6. Send the attached compliance form to the following mail box:

pse_aw189.mbx.aw@leonardocompany.com

As an alternative, gain access to My Communications section on Leonardo WebPortal and compile the "Service Bulletin Application Communication".

S.B. N°189-237 EMERGENCY ALERT

DATE: May 29, 2019



PART IV

- 1. In accordance with AMP DM 89-A-00-20-00-00A-120A-A, prepare the helicopter on ground for a safe maintenance. Disconnect the battery, all electrical power sources and/or the external power supply.
- 2. In accordance with AMP DM 89-A-64-31-03-00A-520A-A, remove the spider plug.
- 3. With reference to Figure 4, check the thermal strip for good adhesion and readability and proceed as follows:
 - 3.1 If the thermal strip is properly installed proceed with step 4;
 - 3.2 If the strip is detached, partially detached or unreadable perform the spider and slider inspection in accordance with accomplishment instructions from step 3 to step 14 of Part II of this SB;
 - 3.3 Replace the thermal strip in accordance with step 3 of Part III of this SB;
 - 3.4 Skip to step 6.

CAUTION

In case the selected thermal strip does not provide a discrete value equal to 121°C, select the lowest value comprised within the range 121±2°C.

- 4. With reference to Figure 4, check the temperature reached by the thermal strip installed on spacer control rod P/N 4F6430A02551. Make sure that the temperature has not reached a value equal to or above 121°C. Record the check result on Table III (refer to Figure 9).
- 5. If temperature has exceeded a value equal to or above 121°C, contact immediately the Product Support Engineering (pse aw189.mbx.aw@leonardocompany.com) and perform the following procedure. Otherwise, skip to Step 6:
 - 5.1 If the helicopter is already compliant with the SB 189-227, perform HUMS data download from AMMC to DTD. Upload the HUMS data to Heliwise.
 - 5.2 Contact immediately the Product Support Engineering (pse aw189.mbx.aw@leonardocompany.com) to receive further instruction before thermal strip and duplex bearing removal and replacement.
 - 5.3 Perform from step 3 to step 14 of Part II of this SB.
 - 5.4 Perform from step 3 to step 10 of Part V of this SB.
 - 5.5 Remove the spacer control rod P/N 4F6430A02551, without removing the thermal strip.
 - Take a picture of the thermal strip, installed on the removed spacer control rod P/N 4F6430A02551 and send it to Product Support Engineering (pse aw189.mbx.aw@leonardocompany.com).



CAUTION

Pay attention to prevent rod rotation, when screwing / un-screwing the castellated nut, holding the rod square end.

5.7 In accordance with the applicable steps of UTC SB 67-0006, remove and discard the cotter pin and the lockwire from the castellated nut of the TRA back-end and remove the nut.

NOTE

Before removal of the TR duplex bearing, take note of its installation orientation marking "OUT" on the outboard visible face.

After removal mark "IN" on the inboard opposite face of the TR duplex bearing.

Use an indelible pen.

- 5.8 In accordance with AMP DM 89-A-64-31-05-00A-520A-B, remove the TR duplex bearing.
- 5.9 Collect the grease leaked from the TR duplex bearing "IN" marked side in a container different from the one used before.
- 5.10 Take a picture of both faces of the removed TR duplex bearing and send them to PSE (pse_aw189.mbx.aw@leonardocompany.com) before returning the bearing.
- 5.11 Clean by means of a soft lint-free cloth the housing of the TR duplex bearing, the rod visible part and the internal side of the spider plug.
- 5.12 In accordance with AMP DM 89-A-64-31-05-00A-720A-B, install a new TR duplex bearing.

CAUTION

Pay attention to prevent rod rotation, when screwing / un-screwing the castellated nut, holding the rod square end.

- 5.13 In accordance with the applicable steps of UTC SB 67-0006, reinstall castellated nut of the TRA back-end and cotter pin P/N EN2367-29020 and lockwire P/N MS20995C20.
- 5.14 With reference to Figure 3, restore the slippage marking on the castellated nut from the hinge bracket element to the rod.
- 5.15 In case replacement of the TR duplex bearing is required, please return immediately (within 2 days) the removed TR duplex bearing, the collecting containers of the grease and the thermal strip to Leonardo Helicopters. Contact

S.B. N°189-237 EMERGENCY ALERT

DATE: May 29, 2019



- the Product Support Engineering (pse aw189.mbx.aw@leonardocompany.com) to receive the proper instructions to return the removed component.
- 5.16 In accordance with AMP DM 89-A-64-31-01-00A-720A-A, while performing installation of TR pitch links, it is possible to re-protect TR pitch links and the scissors using the following procedure
 - 5.16.1 Clean the bolts by means of cleaning solvent.
 - 5.16.2 Check the bolts looking for corrosion. Contact the Product Support Engineering (pse_aw189.mbx.aw@leonardocompany.com) in case of any findings.
 - 5.16.3 Protect the parts using Tectyl Grade I or Thixoflex Black as a valid alternative.
- 5.17 Go to step 6.
- 6. In accordance with AMP DM 89-A-64-31-03-00A-720A-A, install the spider plug.
- 7. Return the helicopter to a ready to flight condition and record for compliance with Part IV of this Service Bulletin on the helicopter logbook.

In case of any findings, report within 2 days the inspection results along with the available records of the previous checks.

8. Send the attached compliance form and the compiled Table III to the following mail box:

pse_aw189.mbx.aw@leonardocompany.com

As an alternative, gain access to My Communications section on Leonardo WebPortal and compile the "Service Bulletin Application Communication".



PART V

- 1. In accordance with AMP DM 89-A-00-20-00-00A-120A-A, prepare the helicopter on ground for a safe maintenance. Disconnect the battery, all electrical power sources and/or the external power supply.
- 2. In accordance with AMP DM 89-A-64-31-03-00A-520A-A, remove the spider plug.
- 3. Perform a detailed inspection of TR duplex bearing in accordance with the following procedure:
 - 3.1 Check the visible part of the TR duplex bearing for particles absence.

CAUTION

Pay attention not to damage the thermal strip during the grease sampling from the bearing housing.

- 3.2 Check the visible part of the TR duplex bearing and/or the spider plug for grease leakage and confirm absence of any particles by finger touch.
- 3.3 Put a small quantity of grease using a small spatula in a transparent container and add a solvent (aliphatic naphtha). Then by using a magnet on the bottom out side of the container check for presence of metallic particles.
- 3.4 Record the result on Table IV (refer to Figure 10) and collect the grease leaked from the visible surface in a proper container.
- 4. If magnetic metallic and/or any other particles are found during accomplishment of step 3 proceed with the following step 5, otherwise skip to step 9.
- 5. Perform from step 3 to step 14 of Part II of this SB.
- 6. Contact immediately the Product Support Engineering (pse aw189.mbx.aw@leonardocompany.com) to receive further instruction before performing the replacement of the TR duplex bearing in accordance with the following procedure:
 - 6.1 If the helicopter is already compliant with the SB 189-227, perform HUMS data download from AMMC to DTD. Upload the HUMS data to Heliwise.

CAUTION

Pay attention to prevent rod rotation, when screwing / un-screwing the castellated nut, holding the rod square end.

6.2 In accordance with the applicable steps of UTC SB 67-0006, remove and discard the cotter pin and the lockwire from the castellated nut of the TRA back-end and remove the nut.

S.B. N°189-237 EMERGENCY ALERT

DATE: May 29, 2019



Before removal of the TR duplex bearing, take note of its installation orientation marking "OUT" on the outboard visible face.

After removal mark "IN" on the inboard opposite face of the TR duplex bearing.

Use an indelible pen.

- 6.3 In accordance with AMP DM 89-A-64-31-05-00A-520A-B, remove the TR duplex bearing.
- 6.4 Collect the grease leaked from the TR duplex bearing "IN" marked side in a container different from the one used before.
- Take a picture of both faces of the removed TR duplex bearing and send them to PSE (pse aw189.mbx.aw@leonardocompany.com) before returning the bearing.
- 6.6 Clean by means of a soft lint-free cloth the housing of the TR duplex bearing, the rod visible part and the internal side of the spider plug.
- 6.7 In accordance with AMP DM 89-A-64-31-05-00A-720A-B, install a new TR duplex bearing.

CAUTION

Pay attention to prevent rod rotation, when screwing / un-screwing the castellated nut, holding the rod square end.

- 6.8 In accordance with the applicable steps of UTC SB 67-0006, reinstall castellated nut of the TRA back-end and cotter pin P/N EN2367-29020 and lockwire P/N MS20995C20.
- 6.9 With reference to Figure 3, restore the slippage marking on the castellated nut from the hinge bracket element to the rod.
- 7. In case replacement of the TR duplex bearing is required, please return immediately (within 2 days) the removed TR duplex bearing and the collecting containers of the grease to Leonardo Helicopters. Contact the Product Support Engineering (pse aw189.mbx.aw@leonardocompany.com) to receive the proper instructions to return the removed component.
- In accordance with AMP DM 89-A-64-31-01-00A-720A-A, while performing installation of TR pitch links, it is possible to re-protect TR pitch links and the scissors using the following procedure
 - 8.1 Clean the bolts by means of cleaning solvent.
 - 8.2 Check the bolts looking for corrosion. Contact the Product Support Engineering



(pse_aw189.mbx.aw@leonardocompany.com) in case of any findings.

- 8.3 Protect the parts using Tectyl Grade I or Thixoflex Black as a valid alternative.
- 9. Clean the visible surface of the TR duplex bearing by means of soft lint-free cloth.
- 10. In accordance with AMP DM 89-A-64-31-03-00A-720A-A, install the spider plug.
- 11. Return the helicopter to a ready to flight condition and record for compliance with Part V of this Service Bulletin on the helicopter logbook.

NOTE

In case of any findings, report within 2 days the inspection results along with the available records of the previous checks.

12. Send the attached compliance form and the compiled Table IV to the following mail box: pse_aw189.mbx.aw@leonardocompany.com

As an alternative, gain access to My Communications section on Leonardo WebPortal and compile the "Service Bulletin Application Communication".

S.B. N°189-237 EMERGENCY ALERT

DATE: May 29, 2019



PART VI

- 1. In accordance with AMP DM 89-A-00-20-00-00A-120A-A, prepare the helicopter on ground for a safe maintenance. Disconnect the battery, all electrical power sources and/or the external power supply.
- 2. In accordance with applicable steps of AMP DM 89-A-64-31-04-00A-520A-A, remove the spider and slider assembly.
- 3. Inspect the visible part of the inboard side of the TR duplex bearing (including the seals) for absence of wear, damages and absence of particles by looking inside the slider cylinder. Record the results on Table V (refer to Figure 11).
- 4. With reference to Figure 6 lock the slider of the sliding control assembly in a bench vice with padded jaws.
- 5. Examine the duplex bearing to find roughness in accordance with the following procedure:

NOTE

- To initiate rotation of the duplex bearing, a break-out force could be necessary. The breakout force is not an indication of roughness.
- Relative axial movement between the inner races is acceptable and shall not be considered as a finding.
- 5.1 Use your fingers to push down on the upper face of the inner race of the duplex bearing.

NOTE

Do not release pressure, continue to apply pressure with your fingers during the subsequent step.

- 5.2 With reference to Figure 6 section A-A Step 1, push the top inner race down and at the same time turn it to feel if there is roughness.
- 5.3 Put your finger into the duplex bearing until you can pull up the lower face of the inner race.

NOTE

Do not release pressure, continue to apply pressure with your finger during the subsequent step.

- 5.4 With reference to Figure 6 section A-A Step 2, pull the bottom inner race in the up direction and at the same time turn it to feel if there is roughness.
- 5.5 Repeat the Step 5.1 thru Step 5.4 at least one time to confirm the results.
- 5.6 Record the results of the previous steps on Table V (refer to Figure 11).



- 6. If any of the checks performed in the steps 3 and 5 fails proceed with the following step, otherwise skip to step 10.
- 7. Contact immediately the Product Support Engineering (pse aw189.mbx.aw@leonardocompany.com) to receive further instruction before performing the replacement of the TR duplex bearing in accordance with the following procedure:
 - 7.1 If the helicopter is already compliant with the SB 189-227, perform HUMS data download from AMMC to DTD. Upload the HUMS data to Heliwise.

Before removal of the TR duplex bearing, take note of its installation orientation marking "OUT" on the outboard visible face.

After removal mark "IN" on the inboard opposite face of the TR duplex bearing.

Use an indelible pen.

- 7.2 In accordance with AMP DM 89-A-64-31-05-00A-520A-B, remove the TR duplex bearing.
- 7.3 Collect the grease leaked from the TR duplex bearing "IN" marked side in a container different from the one used before.
- 7.4 Take a picture of both faces of the removed TR duplex bearing and send them to PSE (pse aw189.mbx.aw@leonardocompany.com) before returning the bearing.
- 7.5 Clean by means of a soft lint-free cloth the housing of the TR duplex bearing, the rod visible part and the internal side of the spider plug.
- 7.6 In accordance with AMP DM 89-A-64-31-05-00A-720A-B, install a new TR duplex bearing.
- 7.7 In accordance with the applicable steps of UTC SB 67-0006, reinstall castellated nut of the TRA back-end and cotter pin P/N EN2367-29020 and lockwire P/N MS20995C20.
- 7.8 With reference to Figure 3, restore the slippage marking on the castellated nut from the hinge bracket element to the rod.
- 8. In case replacement of the TR duplex bearing is required, please return immediately (within 2 days) the removed TR duplex bearing and the collecting containers of the grease to Leonardo Helicopters. Contact the Product Support Engineering (pse_aw189.mbx.aw@leonardocompany.com) to receive the proper instructions to return the removed component.

S.B. N°189-237 EMERGENCY ALERT

DATE: May 29, 2019



- In accordance with AMP DM 89-A-64-31-01-00A-720A-A, while performing installation of TR pitch links, it is possible to re-protect TR pitch links and the scissors using the following procedure
 - 9.1 Clean the bolts by means of cleaning solvent.
 - 9.2 Check the bolts looking for corrosion. Contact the Product Support Engineering (pse aw189.mbx.aw@leonardocompany.com) in case of any findings.
 - 9.3 Protect the parts using Tectyl Grade I or Thixoflex Black as a valid alternative.
- 10. In accordance with applicable steps of AMP DM 89-A-64-31-04-00A-520A-A, reinstall the spider and slider assembly.
- 11. Return the helicopter to a ready to flight condition and record for compliance with Part VI of this Service Bulletin on the helicopter logbook.

In case of any findings, report within 2 days the inspection results along with the available records of the previous checks.

12. Send the attached compliance form and the compiled Table V to the following mail box:

pse_aw189.mbx.aw@leonardocompany.com

As an alternative, gain access to My Communications section on Leonardo WebPortal and compile the "Service Bulletin Application Communication".



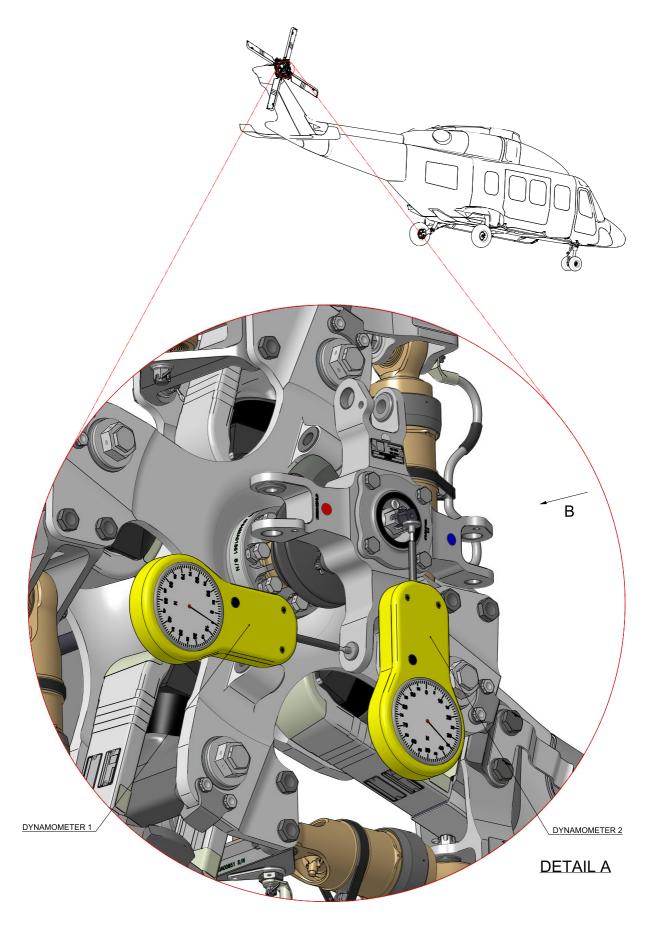


Figure 1

S.B. N°189-237 EMERGENCY ALERT

DATE: May 29, 2019
REVISION: A - September 5, 2019



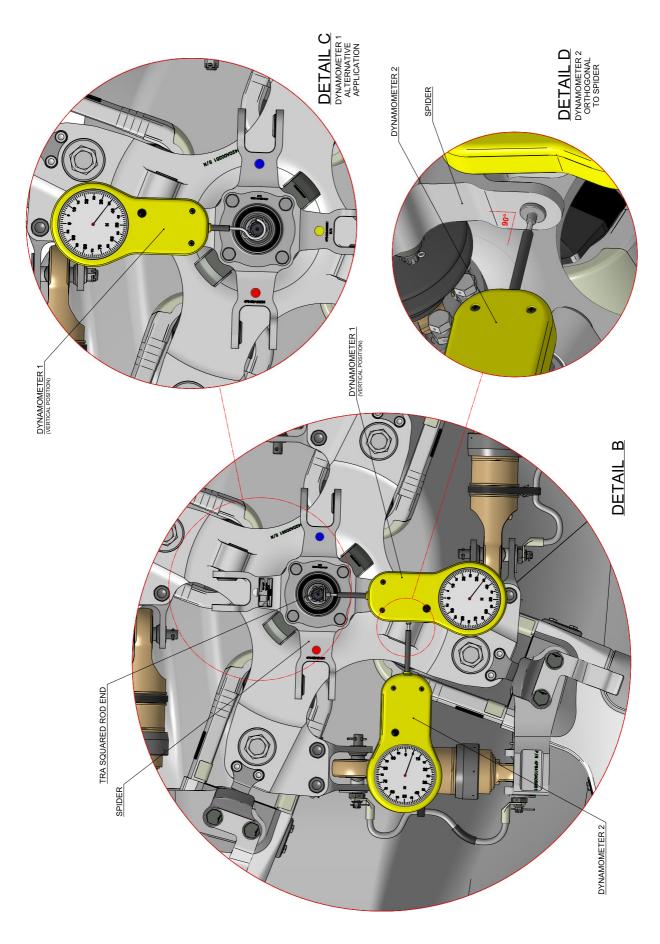


Figure 2

S.B. N°189-237 EMERGENCY ALERT DATE: May 29, 2019 REVISION: A - September 5, 2019





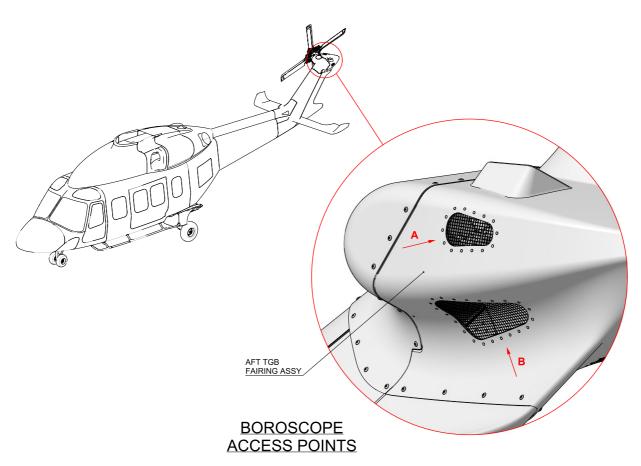


Figure 3

S.B. N°189-237 EMERGENCY ALERT

DATE: May 29, 2019 REVISION: A - September 5, 2019




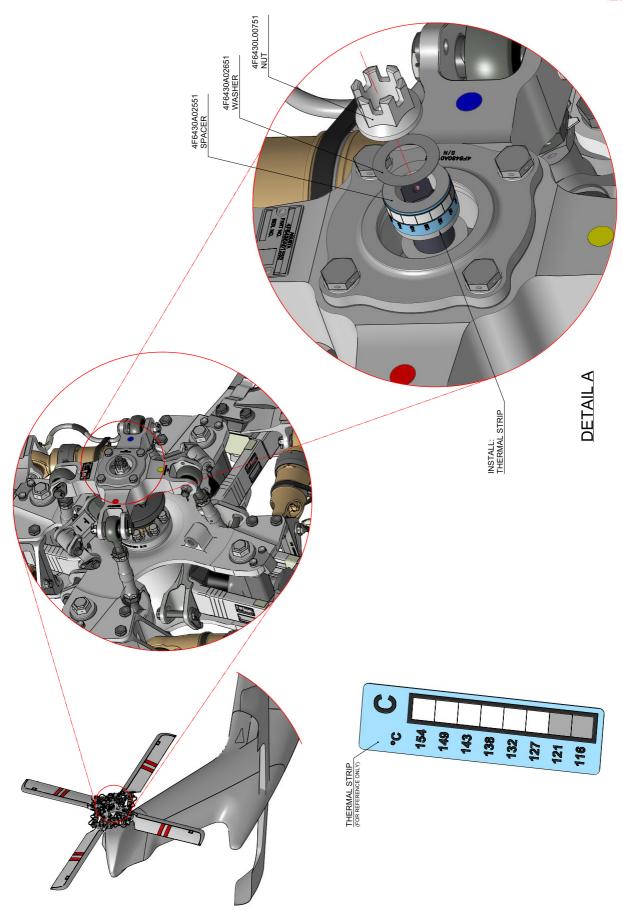


Figure 4

S.B. N°189-237 EMERGENCY ALERT DATE: May 29, 2019 REVISION: A - September 5, 2019



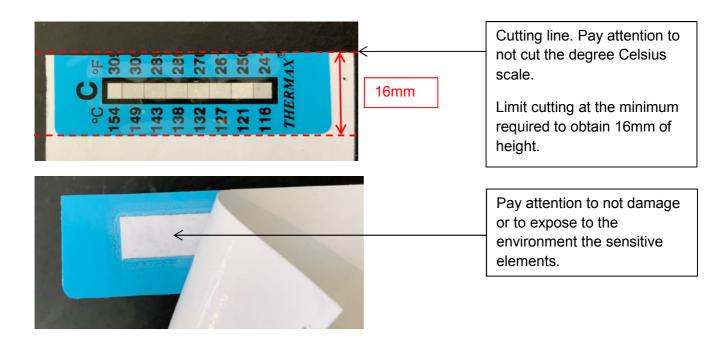

Do not use a thermal strip if after having trimmed it, its sensitive element is exposed to air. See below an example of a badly cut strip.





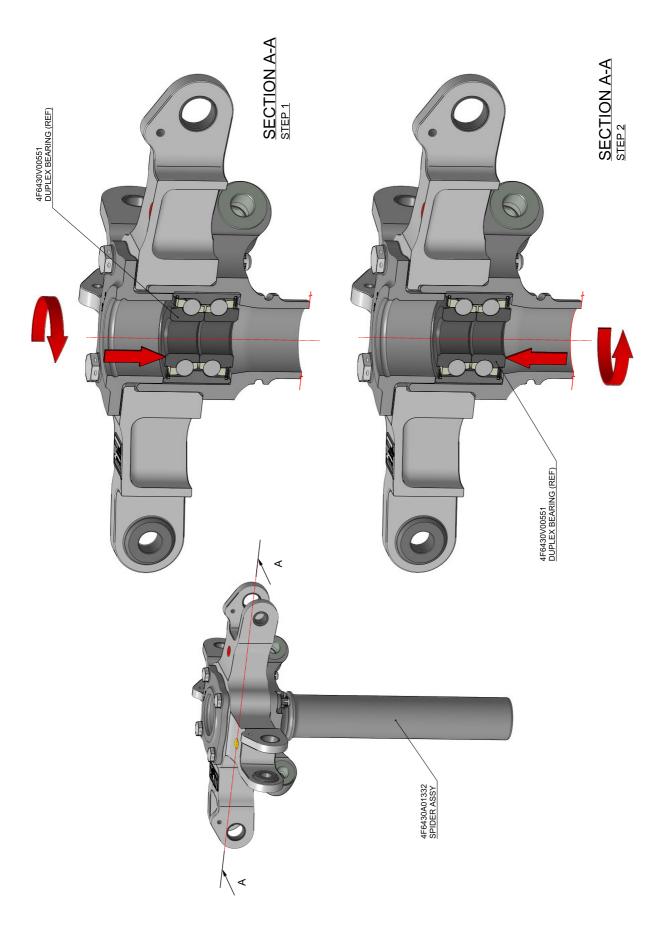


Figure 6



TABLE I

AIRCRAFT S/N	SB COMPLIANCE DATE:
P/N 6F6730V00331 TRA S/N	A/C FH at SB COMPLIANCE DATE:
TRA FH at SB COMPLIANCE DATE	A/C LANDINGS at SB COMPLIANCE DATE:

ACTION	Required	Obtained
PART I		
CASTELLATED NUT paint mark check	NO ROTATION BETWEEN PARTS	

DATE: May 29, 2019
REVISION: A - September 5, 2019



TABLE II

AIRCRAFT S/N	SB COMP
P/N 4F6430V00551 TR DUPLEX BEARING S/N	A/C FH at COMPLIA
TR DUPLEX BEARING FH at SB COMPLIANCE DATE	A/C LAND

SB COMPLIANCE DATE:	
A/C FH at SB COMPLIANCE DATE:	
A/C LANDINGS at SB COMPLIANCE DATE:	

ACTION	Required	Obtained
PART II		
TR DUPLEX BEARING wear and damages check	NO FINDINGS	
TR SPIDER axial play check	ABSENCE of AXIAL PLAY	
TR DUPLEX BEARING roughness check	FREE AND EASY ROTATION	
TR DUPLEX BEARING breakaway torque check – Arm blue, clockwise direction	2 N thru 10 N	
TR DUPLEX BEARING breakaway torque check – Arm yellow, clockwise direction	2 N thru 10 N	
TR DUPLEX BEARING breakaway torque check – Arm red, clockwise direction	2 N thru 10 N	
TR DUPLEX BEARING breakaway torque check – Arm white, clockwise direction	2 N thru 10 N	
TR DUPLEX BEARING breakaway torque check – Arm blue, counterclockwise direction	2 N thru 10 N	
TR DUPLEX BEARING breakaway torque check – Arm yellow, counterclockwise direction	2 N thru 10 N	
TR DUPLEX BEARING breakaway torque check – Arm red, counterclockwise direction	2 N thru 10 N	
TR DUPLEX BEARING breakaway torque check – Arm white, counterclockwise direction	2 N thru 10 N	



TABLE III

AIRCRAFT S/N	
P/N 4F6430V00551 TR DUPLEX BEARING S/N	
TR DUPLEX BEARING FH at SB COMPLIANCE DATE	

SB COMPLIANCE DATE:	
A/C FH at SB COMPLIANCE DATE:	
A/C LANDINGS at SB COMPLIANCE DATE:	

ACTION	Required	Obtained
PART IV		
THERMAL STRIP Temperature check	TEMPERATURE SHALL NOT REACH A VALUE EQUAL TO OR ABOVE 121°C.	



TABLE IV

AIRCRAFT S/N	
P/N 4F6430V00551 TR DUPLEX BEARING S/N	
TR DUPLEX BEARING FH at SB COMPLIANCE DATE	

SB COMPLIANCE DATE:	
A/C FH at SB COMPLIANCE DATE:	
A/C LANDINGS at SB COMPLIANCE DATE:	

ACTION	Required	Obtained
PART V		
TR DUPLEX BEARING Particles check	ABSENCE of ANY PARTICLES	
TR DUPLEX BEARING Grease leakage check	ABSENCE of METALLIC PARTICLES	



TABLE V

AIRCRAFT S/N	SB COMPLIANCE DATE:
P/N 4F6430V00551 TR DUPLEX BEARING S/N	A/C FH at SB COMPLIANCE DATE:
TR DUPLEX BEARING FH at SB COMPLIANCE DATE	A/C LANDINGS at SB COMPLIANCE DATE:

ACTION	Required	Obtained
	PART VI	
TR DUPLEX BEARING Roughness check by fingers	FREE AND EASY ROTATION	
TR DUPLEX BEARING wear, damages and particles check on the inboard side of the bearing	NO FINDINGS	

DATE: May 29, 2019
REVISION: A - September 5, 2019



ANNEX A

UTC MICROTECNICA SERVICE BULLETIN 67-0006 ISSUE 1



PROPRIETARY

Copyright © UTC Aerospace Systems. This document and the information contained herein are the property of Microtecnica Srl. Recipient agrees to hold all such information in confidence and agrees it shall be used only for recipient's equipment or as may otherwise be permitted in an applicable agreement between recipient and Microtecnica Srl. This document and the information contained herein shall not be used for any other purpose, including the creation, manufacture, development, or derivation of any repairs, modifications, spare parts, design, or configuration changes, or to obtain FAA or any other government or regulatory approval for same. Recipient agrees not to disclose such information to any third party, except as may otherwise be provided for in an applicable agreement between recipient and Microtecnica Srl. Copying or disclosure of this document and the information contained herein by anyone without Microtecnica Srl. prior written permission is not authorized and may result in criminal and/or civil liability.

Microtecnica S.r.l. assumes no liability whatsoever, whether contractual, warranty, tort or otherwise, for unauthorized alteration or alterations not performed in accordance with Microtecnica S.r.l. approved procedures.

This document does not contain export controlled technology or export controlled technical data.

IT Export Classification: NSR

Copyright (c) 2018, UTC Aerospace Systems

TAIL ROTOR ACTUATOR (TRA) PN C161223-1

TORQUE CHECK AND RE-APPLICATION ON CASTELLATED NUT OF ROD

Issue 1 - Nov. 29/18

Subject to the restriction on the title or cover page. IT Export Classification: NSR

SB 67 -0006 Page 1 of 10

S.B. N°189-237 EMERGENCY ALERT

DATE: May 29, 2019

1. PLANNING INFORMATION

A. Effectivity

All Microtecnica TAIL ROTOR ACTUATOR (TRA) reported in Table 1 (all S/N's).

Table 1 - Components Affected

Nomenclature	Manufacturer	Type Certificate Holder	Manufacturer	
	Part Number (MT)	Part Number (LH)	Cage Code	
Tail Rotor Actuator	C161223-1	6F6730V00331	A0076	

B. Concurrent Requirements

None.

C. Reason

To check and re-apply the torque of the castellated nut (60) connecting the rod (150) to the input lever (110) of the Tail Rotor Actuator (see Fig. 1a and 1b).

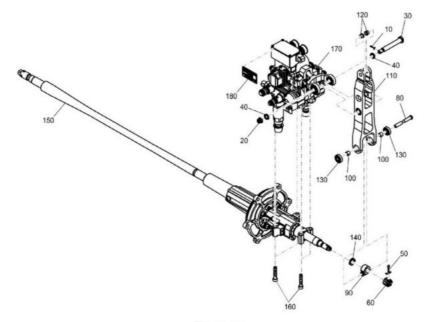


Figure 1a

Issue 1 - Nov. 29/18

Subject to the restriction on the title or cover page. IT Export Classification: NSR

SB 67 -0006 Page 2 of 10



SERVICE BULLETIN

CIRCULATE PROMPTLY

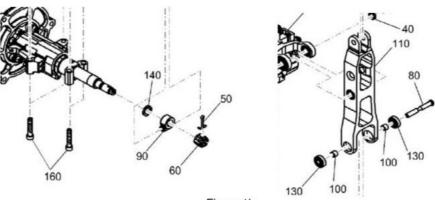


Figure 1b

Table 1.1 - List of Items

Item N. (ref. Fig. 1)	Item Description		
50	cotter pin		
60	castellated nut		
90	hinge bracket element		
110	input lever		
150	rod		

D. Description & Solution

This Service Bulletin gives the instruction to check and re-apply the Torque of the castellated nut (60).

E. Compliance

It is recommended to introduce this Service Bulletin in accordance with Leonardo Helicopters Service Bulletin.

F. Approval

Government or other regulatory agency approval of this service bulletin is the responsibility of Leonardo Helicopters.

G. Manpower

The Manpower for the accomplishment of these operations is 1 hour.

H. Weight and Balance

Not Affected.

I. Electrical Load Data

Not Applicable.

Issue 1 - Nov. 29/18

Subject to the restriction on the title or cover page. IT Export Classification: NSR

SB 67 -0006 Page 3 of 10

S.B. N°189-237 EMERGENCY ALERT DATE: May 29, 2019



J. Software Accomplishment Summary

Not Applicable.

K. References

Not applicable.

L. Other Publications Affected

Not applicable.

M. Interchangeability or Intermixability of Parts

Not applicable.

2. MATERIAL INFORMATION

A. Material Price and Availability

The material is composed of the parts listed in the Table below.

Table 2.1 - List of parts

MT Code	Standard Part Number	Qty	Keyword
083321	EN2367-29020 (Alternative 3.2x20-DIN94 – Stainless Steel)	1	Cotter Pin (Fig. 1 Item 50)

Note: all the above parts as per Table 2.1 can be locally procured or requested to Leonardo Helicopters.

All consumable materials are listed in Table 3.3. of para. 3.H.

B. Industry Support Information

This modification will be introduced in accordance with one of the options noted below:

- by organizational authorized helicopter maintenance personnel.
- by Microtecnica maintenance personnel

C. Material Necessary For Each Unit

Locking Wire MS20995C20 in accordance with NASM 33540.

D. Material Necessary For Each Spare

Locking Wire MS20995C20 in accordance with NASM 33540.

E. Reidentified Parts

Not applicable.

F. Tooling - Price and Availability

Standard tools have to be used for the activities required by this Service Bulletin.

Issue 1 - Nov. 29/18

Subject to the restriction on the title or cover page. IT Export Classification: NSR

SB 67 -0006 Page 4 of 10

3. ACCOMPLISHMENT INSTRUCTIONS

A. General

All the values to be recorded as indicated in the following points have to be reported on the registration form in the last page of this Service Bulletin.

All the pictures taken as indicated in the following points have to be provided together with the registration form to Leonardo Helicopters within the completion time required by Leonardo Helicopters Service Bulletin.

The Service Bulletin can be carried out with the actuator removed from the helicopter provided that it is installed in a suitable vice locking the flange of the actuator.

B. Cleaning procedure

When necessary, cold solvent and a natural bristle brush or a cloth that does not contain any lint should be used to clean the external surfaces of the TAIL ROTOR ACTUATOR (TRA).

C. Record the Torque on the castellated nut (60)

1. Take a picture of the castellated nut (60) area of the Tail Rotor Actuator seen from the input lever (110) side (see Fig. 2 below for reference):



Figure 2

Issue 1 - Nov. 29/18

Subject to the restriction on the title or cover page.
IT Export Classification: NSR

SB 67 -0006 Page 5 of 10

DATE: May 29, 2019



- 2. Check the paint mark for absence of evidence of rotation between the parts. Record the $result\ of\ the\ check$ in the template provided at the end of this Service Bulletin.
- 3. Cut and remove the locking wire.
- 4. Bend the cotter pin (50) end in order to re-align it with the hole in the rod (150). If cotter pin (50) is distorted by castellated nut (60) rotation, then rotate castellated nut (60) to allow cotter pin (50) removal.
- 5. Carefully remove the cotter pin (50) from its housing and scrap it.
- 6. Manual check if the castellated nut (60) is loose. **Record the result.**If castellated nut (60) is loose then contact Leonardo Helicopters for further instructions.
- 7. Hold the squared end of the rod (150) (input lever side) using the proper socket or a standard wrench (8mm size). Set the calibrated torque wrench to 10 Nm and slowly tighten the castellated nut (60). Verify for relative rotation between the castellated nut (60) and the hinge bracket element (90). If no relative rotation is detected, then increase the setting of the torque wrench by 5 Nm at a time and repeat slowly tightening until the castellated nut (60) relatively rotates with respect to the hinge bracket element (90). **Record the value of the torque to have relative rotation.**

If no relative rotation is detected with a maximum tightening torque of **49 Nm**, then stop the tightening procedure and **record "torque greater than 49 Nm"**.

D. Apply the Torque on the castellated nut (60)

1. Remove the paint mark (as per Point 3.B) from the castellated nut (60), the rod end (150) and the hinge bracket element (90) using scotch brite and/or solvent (MEK or equivalent), see Fig. 1 for reference.

Caution: in all the operation below, do not move the input lever (110), do not disconnect the input lever (110) from the rod (150).

2. Apply tie rap on the input lever (110) as per Fig. 3.

Issue 1 - Nov. 29/18

Subject to the restriction on the title or cover page. IT Export Classification: NSR

SB 67 -0006 Page 6 of 10



CIRCULATE PROMPTLY



Figure 3

- 3. Hold the squared end of the rod (150) (input lever side) using the proper socket or a standard wrench (8mm size) and unscrew the castellated nut (60).
- 4. Carefully remove completely the castellated nut (60) from the rod (150) without disconnecting the hinge bracket element (90) from the rod (150).
- 5. Polish the castellated nut (60) surface of contact and clean it by means of abrasive paper (grit 600). Clean the hinge bracket element (90) contact area with lint free cloth. Sliding marks in the contact area of castellated nut (60) and hinge bracket element (90) are acceptable.
- 6. Clean the rod (150) thread with lint free cloth without using solvent. Note the thread area may present a different colour because of molybdenum disulphate.
- 7. Apply a thin layer of grease as per MIL-PRF-81322 on the castellated nut (60) contact face.
- 8. Hold the squared end of the rod (150) (input lever side) using the proper socket or a standard wrench (8mm size) and slowly tighten the castellated nut (60) by means of calibrated torque wrench set to 40 Nm up to the contact with the hinge bracket element (90).
- 9. Check that the hole on the rod (150) is aligned with one of the available slots in the castellated nut (60). If the hole is not aligned, increase the torque wrench setting by 1 Nm per step and verify the alignment. **The maximum applicable torque is 49 Nm**. If the alignment is not achieved yet, unscrew the castellated nut (60) and repeat the torque application starting from 40 Nm. **Record the applied torque**.
- 10. Insert the new cotter pin (50) into the hole in the rod (150). Bend the cotter pin (50) end (the preferred configuration is shown in Fig. 2) in order to minimize axial or rotational cotter pin (50)movement.

Issue 1 - Nov. 29/18

Subject to the restriction on the title or cover page. IT Export Classification: NSR

SB 67 -0006 Page 7 of 10

S.B. N°189-237 EMERGENCY ALERT

DATE: May 29, 2019

- 11. Install the Locking Wire MS20995C20 in accordance with NASM 33540 as per Fig. 2 in order to avoid castellated nut (60) unscrewing.
- 12. Cut and remove the tie rap from the input lever (110).
- 13. Apply a coloured paint mark on the castellated nut (60) from the hinge bracket element (90) to the rod (150) using a narrow brush as per Fig. 4.



Figure 4

14. Mark "SB 67-0006" on the input lever (110) with permanent ink pen as per Fig. 5.



Figure 5

- 15. Take at least two pictures showing cotter pin (50), locking wire installation and coloured paint mark application.
- 16. Record compliance with this Service Bulletin SB 67-0006 on the relevant component log card.

Issue 1 - Nov. 29/18

Subject to the restriction on the title or cover page. IT Export Classification: NSR

SB 67 -0006 Page 8 of 10



E. Re-identification

Refer to Point C.19 of paragraph 3.

F. Functional tests

Not applicable.

G. SPARES

Not applicable

H. CONSUMABLE MATERIALS

Table 3.3 List of consumables

Material
Locking wire MS20995C20
Paint
Abrasive Paper (grit 600)
Grease MIL-PRF-81322
Solvent MEK

Note: all the parts as per Table 3.3 above can be locally procured.

I. Requirement after job completion

After the accomplishment of the procedure as per para. 3, complete the registration form situated at the bottom of this Service Bulletin and return it to Leonardo Helicopters within the completion time required by Leonardo Helicopters Service Bulletin.

Issue 1 - Nov. 29/18

Subject to the restriction on the title or cover page. IT Export Classification: NSR

SB 67 -0006 Page 9 of 10

S.B. N°189-237 EMERGENCY ALERT

DATE: May 29, 2019



AW169 - AW189

TAIL ROTOR ACTUATOR (TRA) PN C161223-1 (LH P/N 6F6730V00331)

Torque check and re-application on the Castellated Nut of the Rod

Customer Name:
Helicopter Serial Number:
Tail Rotor Actuator Serial Number:
C.2. Paint Mark rotation (Yes/No):
C.6. Castellated Nut loose (Yes/No):
C.7. Value of the torque to have relative rotation between the Castellated Nut and the Hinge Bracket Element:
D.9. Value of the torque re-applied to the Castellated Nut of the Rod:
Visual checks after the torque re-applied:
• D.11. The locking wire is properly installed:
D.13.The parts are marked with paint:
• D.14. "SB 67-0006" is marked on the Input Lever:
Torque check and re-application to the Castellated Nut of the Rod accomplished by (Operator Name):
Execution date:
Ssue 1 – Nov. 29/18 Subject to the restriction on the title or cover page SB 67 -00

IT Export Classification: NSR

Page 10 of 10



Please send to the following address:		SERVICE BULLETIN COMPLIANCE FORM		Date:		
LEONARDO S.p.A.						
CUSTOMER SUPPORT & SE		Number:				
PRODUCT SUPPORT ENGINEE Via Giovanni Agusta, 520	RING & LICENSES DEPT.					
21017 Cascina Costa di Samara		Revision:				
Tel.: +39 0331 225036 Fax: +39	0331 225988					
Customer Name and Addre	ess:			Telephone:		
			тевернопе.			
				Fax:		
			B.T. Compliance Date:			
				•		
,					I	
Helicopter Model	S/N		Total N	umber	Total Hours	T.S.O.
Remarks:						
Information:						
We request your cooperation in filling this form, in order to keep out statistical data relevant to aircraft configuration up-to-date. The form should be filled in all its parts and sent to the above address or you can communicate the application also via Technical Bulletin Application Communication Section placed in Leonardo AW Customer Portal - MyCommunications Area. We thank you beforehand for the information given.						